

C.L. "BUTCH" OTTER – Governor RICHARD M. ARMSTRONG – Director DEBRA RANSOM, R.N.,R.H.I.T., Chief BUREAU OF FACILITY STANDARDS 3232 Elder Street P.O. Box 83720 Boise, ID 83720-0036 PHONE 208-334-6626 FAX 208-364-1888

October 6, 2008

Joseph A. Messmer, Administrator Mercy Medical Center 1512 12th Avenue Road Nampa, ID 83686

RE:

Mercy Medical Center, provider #130013

Dear Mr. Messmer:

This is to advise you of the findings of the Medicare/Licensure Fire Life Safety Survey, which was concluded at your facility, Mercy Medical Center, on September 29, 2008.

Enclosed is a Statement of Deficiencies/Plan of Correction, Form CMS-2567, listing Medicare deficiencies and a similar form listing State licensure deficiencies. In the spaces provided on the right side of each sheet, please provide a Plan of Correction. <u>It is important</u> that your Plan of Correction address each deficiency in the following manner:

- 1. What corrective action(s) will be accomplished for those individuals found to have been affected by the deficient practice;
- 2. How you will identify other individuals having the potential to be affected by the same deficient practice and what corrective action(s) will be taken;
- 3. What measures will be put in place or what systemic change you will make to ensure that the deficient practice does not recur;
- 4. How the corrective action(s) will be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place; and,
- 5. Include dates when corrective action will be completed. 42 CFR 488.28 states ordinarily a provider is expected to take the steps needed to achieve compliance within 60 days of being notified of the deficiencies. Please keep this in mind when preparing your plan of correction. For corrective actions which require construction, competitive bidding, or other issues beyond the control of the facility, additional time may be granted.

Sign and date the form(s) in the space provided at the bottom of the first page.

Joseph A. Messmer, Administrator October 6, 2008 Page 2 of 2

After you have completed your Plan of Correction, return the original to this office by October 20, 2008, and keep a copy for your records.

Thank you for the courtesies extended to us during our visit. If you have any questions, please call or write this office at (208)334-6626.

Sincerely,

MARK P. GRIMES

Health Facility Surveyor

Facility Fire Safety and Construction Program

MPG/lj

Enclosures

DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

(X1) PROVIDER/SUPPLIER/CLIA

STATEMENT OF DEFICIENCIES

PRINTED: 10/01/2008 FORM APPROVED OMB NO. 0938-0391

(X3) DATE SURVEY

AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - ENTIRE HOSPITAL B. WING 130013 10/02/2008 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 1512 TWELFTH AVENUE ROAD **MERCY MEDICAL CENTER** NAMPA, ID 83686 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE COMPLETE PRÉFIX PREFIX REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG DATE TAG DEFICIENCY) K 000 **INITIAL COMMENTS** K 000 Mercy Medical Center is a four story type 1 constructed hospital which was originally constructed in 1966; the building has gone through multiple renovations and additions. The building is protected by a complete sprinkler system, fire alarm system with detection and has a type 1 essential electrical system. The facility is licensed for 152 beds, with a census of 45 on the beginning day of the survey (9/29/08). The facility was surveyed under the 2000 Edition of the Life Safety Code, Chapter 19, Existing Health Care Occupancies, in accordance with 42 CFR 482.41 (b) and IDAPA 16.03.14 Rules and Minimum Standards for Hospitals in Idaho. The following deficiency was cited during the recertification survey conducted on September 29, 2008 through October 2, 2008. The surveyor conducting the survey was: RECEIVED Mark P. Grimes, Supervisor Facility Fire Safety and Construction K 056 NFPA 101 LIFE SAFETY CODE STANDARD K 056 OCT 17 2008 If there is an automatic sprinkler system, it is FACILITY STANDARDS installed in accordance with NFPA 13. Standard for the Installation of Sprinkler Systems, to provide complete coverage for all portions of the building. The system is properly maintained in accordance with NFPA 25, Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. It is fully supervised. There is a reliable, adequate water supply for the system. Required sprinkler systems are equipped with water flow and tamper switches, which are electrically LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE TITLE (X6) DATE

(X2) MULTIPLE CONSTRUCTION

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14

021199

Mooner

enz

DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

STATEMENT OF DEFICIENCIES

PRINTED: 10/01/2008 FORM APPROVED OMB NO. 0938-0391

(X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED 01 - ENTIRE HOSPITAL A. BUILDING B. WING 130013 10/02/2008 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER **MERCY MEDICAL CENTER 1512 TWELFTH AVENUE ROAD** NAMPA, ID 83686 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE COMPLETE PREFIX PREFIX REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG DATE TAG DEFICIENCY) K 056 Continued From Page 1 K 056 connected to the building fire alarm system. 19.3.5 On September 29, 2008, the ordinary 9/29/08 response sprinkler heads were changed to quick response sprinkler heads. This was completed on the same day they were noted by the surveyor as deficient. This Standard is not met as evidenced by: Based upon observation and staff interview, the facility failed to ensure sprinkler heads in On October 3, 2008, the entire hospital 10/3/08 remodeled areas were compatible with existing heads installed in adjacent was surveyed and no more mixing of corridors/compartments. This deficient practice ordinary and quick response sprinkler could result in ordinary response heads not heads were found. functioning when needed and causing additional fire spread, potentially affecting all patients, staff and visitors within the facility. The facility is 0/10/08 On October 10, 2008, the Facilities licensed for 152 beds and had a census of 45 on Department developed a policy that the day of the survey. states any further sprinkler head modification(s) will be monitored and Findings include: the results will be reported to the 1. During the facility tour on September 29, 2008 Environment of Care Committee. between 1:40 pm and 3:50 pm observation of the sprinkler system disclosed ordinary response heads and quick response heads used within the All future construction projects will be same compartment where the main lobby monitored to assure and verify that corridor intersected the gift shop corridor. Nine contractors are installing the correct ordinary heads were located in an area sprinkler heads and there is no mixing contiguous to the lobby which is covered by quick response heads. of ordinary and quick response sprinkler heads. 2. During the facility tour on September 29, 2008 between 1:40 pm and 3:50 pm observation of the sprinkler system disclosed ordinary response heads and quick response heads used within the same compartment where the day surgery and recovery corridors intersect. Four ordinary heads were located in an area contiguous to the corridors that are covered by quick response heads. These findings were acknowledged by the Director of Facility Services and the Vice

DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 10/01/2008 FORM APPROVED OMB NO. 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIE IDENTIFICATION NU	R/CLIA MBER:	A. BUILDIN		(X3) DATE S COMPLI	URVEY ETED		
130013				B. WING _		10/02/2008			
NAME OF P	ROVIDER OR SUPPLIER		I		STATE, ZIP CODE				
MERCY MEDICAL CENTER			1512 TWELFTH AVENUE ROAD NAMPA, ID 83686						
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			ID PREFIX TAG	PROVIDER'S PLAN OF COF (EACH CORRECTIVE ACTION CROSS-REFERENCED TO THE A DEFICIENCY)	SHOULD BE	(X5) COMPLETE DATE		
K 056	Continued From Page 2			K 056					
	President/Chief Ad	ministrative Officer waters to correct the de							

JSEO21

021199

PRINTED: 10/01/2008 FORM APPROVED

Bureau of Facility Standards STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING B. WING 10/02/2008 130013 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 1512 TWELFTH AVENUE ROAD **MERCY MEDICAL CENTER** NAMPA, ID 83686 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** (EACH CORRECTIVE ACTION SHOULD BE COMPLETE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DATE DEFICIENCY) B 000 16.03.14 Initial Comments B 000 Mercy Medical Center is a four story type 1 constructed hospital which was originally constructed in 1966; the building has gone through multiple renovations and additions. The building is protected by a complete sprinkler system, fire alarm system with detection and has a type 1 essential electrical system. The facility is licensed for 152 beds, with a census of 45 on the beginning day of the survey (9/29/08). The facility was surveyed under the 2000 Edition of the Life Safety Code, Chapter 19, Existing Health Care Occupancies, in accordance with 42 CFR 482.41 (b) and IDAPA 16.03.14 Rules and Minimum Standards for Hospitals in Idaho. The following deficiency was cited during the recertification survey conducted on September 29, 2008 through October 2, 2008. The surveyor conducting the survey was: RECEIVED Mark P. Grimes, Supervisor Facility Fire Safety and Construction OCT 17 2008 BB162 16.03.14.510.02 Life Safety Code Requirements BB162 FACILITY STANDARDY Life Safety Code Requirements. The hospital shall meet such provisions of the "Life Safety Code", 1985 Edition, of the National Fire Protection Association as are applicable to Health Care Occupancies which is incorporated by reference. Any hospital in compliance with either the 1967 Edition of the "Life Safety Code" or the 1981 Edition of the "Life Safety Code" prior to the effective date of these rules is considered to be in compliance with this section so long as the

hospital continues to remain in compliance with

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

STATE FORM

- Mark a. Mooney

Fresident /CEO
JSEO21

If continuation sheet 1 of 2

(X6) DATE

021199

PRINTED: 10/01/2008 FORM APPROVED

Bureau of Facility Standards

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION

(X1) PROVIDER/SUPPLIER/CLIA **IDENTIFICATION NUMBER:**

(X2) MULTIPLE CONSTRUCTION

A. BUILDING 01 (X3) DATE SURVEY COMPLETED

130013

B. WING ___

10/02/2008

NAME OF PROVIDER OR SUPPLIER

STREET ADDRESS, CITY, STATE, ZIP CODE

1512 TWELFTH AVENUE ROAD

MERCY MEDICAL CENTER		1512 TWELFTH AVENUE ROAD NAMPA, ID 83686					
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCI (EACH DEFICIENCY MUST BE PRECEDED B' REGULATORY OR LSC IDENTIFYING INFORM	Y FULL	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE		
BB162	Continued From Page 1		BB162				
	that Edition of the "Life Safety Code." In Codes are available in the licensing ago the Department. Remodelings, additions, and/or upgrade building systems in existing hospitals at the minimum standards set forth in the Edition of the "Life Safety Code" for neconstruction. In the event of a conflict between the account of the standard of the set of	gency of ding of shall meet a 1985 ew		On September 29, 2008, the ordinary response sprinkler heads were changed to quick response sprinkler heads. This was completed on the same day they were noted by the surveyor as deficient.	9/29/08		
	edition of the Life Safety Code and app state or local building, fire, electrical, p zoning, heating, sanitation or other app codes, the most restrictive shall govern This Rule is not met as evidenced by: The following deficiencies were cited a	olicable lumbing, olicable n.		On October 3, 2008, the entire hospital was surveyed and no more mixing of ordinary and quick response sprinkler heads were found.	10/3/08		
	above facility under federal K tags: K0 the annual Fire/Life Safety survey cond September 29 - October 2, 2008. The surveyed under the LIFE SAFETY CO Edition, Existing Health Care Occupan IDAPA 16.03.14 Rules and Minimal St for Hospitals. Refer to federal form 2567 for citation	56 during ducted on facility was DE, 2000 ncy, and andards		On October 10, 2008, the Facilities Department developed a policy that states any further sprinkler head modification(s) will be monitored and the results will be reported to the Environment of Care Committee.	10/10/08		
	Refer to federal form 2007 for Gration	icat.		All future construction projects will be monitored to assure and verify that contractors are installing the correct sprinkler heads and there is no mixing of ordinary and quick response sprinkler heads.			
STATE FOR	1	021199	1	JSFO21 If conti	nuation s		